# 

## **INSTRUCTIONS**

# BX-RLA2 REFLECTED LIGHT BRIGHTFIELD/ DARKFIELD ILLUMINATOR

This instruction manual is for the Olympus Reflected Light Brightfield/Darkfield Illuminator Model BX-RLA2. The BX-RLA2 is capable of brightfield and darkfield observations under the reflected light when it is installed on the BX51RF/BX51TRF system microscope frame together with the BXFM focusing unit. To ensure the safety, obtain optimum performance and to familiarize yourself fully with the use of this unit, we recommend that you study this manual thoroughly before operating the microscope. Retain this instruction manual in an easily accessible place near the work desk for future reference.



## **CONTENTS**

Correct assembly\* and adjustments are critical for the microscope to exhibit its full performance. If you are going to assemble the microscope yourself, please read Chapter 9, "ASSEMBLY" (pages 26 to 27) carefully.

IM	PORTANT - Be sure to read this chapter for safe use of the equipment	1-2
1	SYSTEM DIAGRAM	3
2	NOMENCLATURE OF BX-RLA2	4
3	REFLECTED LIGHT BRIGHTFIELD/DARKFIELD OBSERVATION PROCEDURE	5-6
4	USING THE CONTROLS OF BX-RLA2	7-11
	<ol> <li>Selecting the Light Path</li> <li>Centering the Field Iris Diameter (FS)</li> <li>Centering the Aperture Iris Diaphragm (AS)</li> <li>Using the ND Filter Knob</li> <li>Using the Filters</li> </ol>	
5	STAGE FOR METALLURGICAL SPECIMENS	12-13
	1 Placing the Specimen 2 Using the Y-Axis Lock Lever	
6	OBSERVATION METHODS	14-19
	6-1 Reflected Light Brightfield/Darkfiled Observation 6-2 Reflected Light Nomarski DIC Observation 6-3 Reflected Light Simplified Polarized Light Observation	14-19
7	SPECIFICATIONS	20
8	OPTICAL CHARACTERISTICS «UIS2 Series»	21-25
9	ASSEMBLY	26-27

#### **IMPORTANT**

#### **Getting Ready**

- 1. A microscope is a precision instrument. Handle it with care and avoid subjecting it to sudden or severe impact.
- 2. Do not use the microscope where it is subjected to direct sunlight, high temperature and humidity, dust or vibrations.
- 3. This unit can be used with an intermediate attachment such as a U-CA magnification changer or U-EPA2 eyepoint adjuster.

#### 2 Maintenance and Storage


- 1. To clean the lenses and other glass components, simply blow dirty away using a commercially available blower and wipe gently using a piece of cleaning paper (or clean gauze).
  - If a lens is stained with fingerprints or oil smudges, wipe it gauze slightly moistened with commercially available absolute alcohol.
- ▲Since the absolute alcohol is highly flammable, it must be handled carefully.
  - Be sure to keep it away from open flames or potential sources of electrical sparks for example, electrical equipment that is being switched on or off.
  - Also remember to always use it only in a well-ventilated room.
- 2. Do not attempt to use organic solvents to clean the components other than the glass components. To clean them, use a lint-free, soft cloth slightly moistened with a diluted neutral detergent.
- 3. Never attempt to disassemble any part of the microscope.
- 4. When not using the microscope, set the main switch to " OFF), wait until the lamp housing has cooled down, and keep the microscope covered with a dust cover.
- 5. When disposing of this product, check the regulations and rules of your local government and be sure to observe them.

#### 3 Caution

If this unit is used in a manner not specified by this manual, the safety of the user may be imperiled. In addition, the equipment may also be damaged. Always use the equipment as outlined in this instruction manual.


The following symbols are used to set off text in this instruction manual.

- **A**: Indicates that failure to follow the instructions in the warning could result in bodily harm to the user and/or damage to equipment (including objects in the vicinity of the equipment).
- ★: Indicates that failure to follow the instructions could result in damage to equipment.
- O: Indicates commentary (for ease of operation and maintenance).

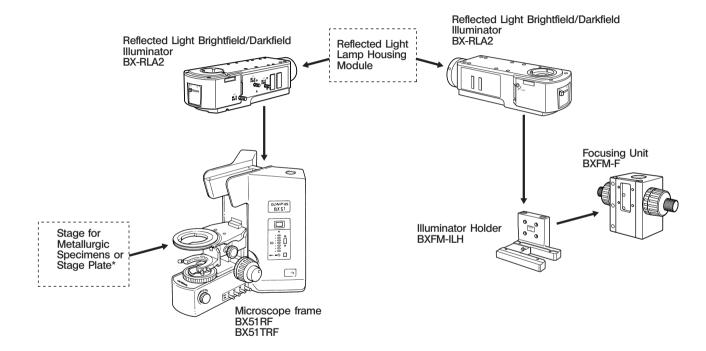


<sup>\*</sup> Replace the standard stage with the stage for metallurgic specimens or the specimen holder with the stage plate for edsier operation.

## NOMENCLATURE OF BX-RLA2

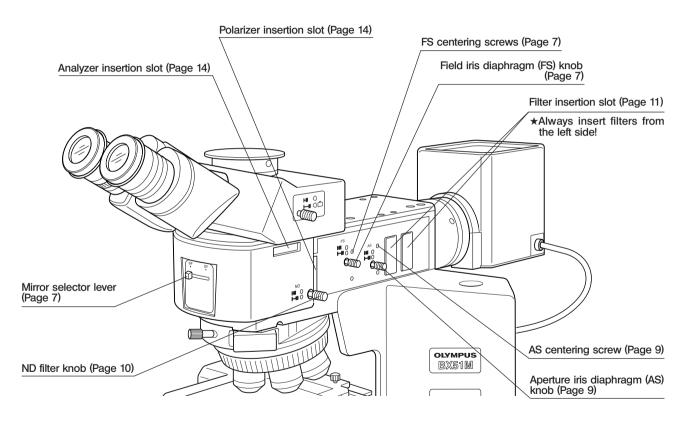


#### REFLECTED LIGHT BRIGHTFIELD/DARKFIELD OBSERVATION PROCEDURE

The following flow shows the basic operating procedure for reflected light brightfield or darkfield observation. The operating procedures for polarized light and Nomarski DIC observations will be described separately in their descriptions. (The microscope frame used is the BX51TRF.)

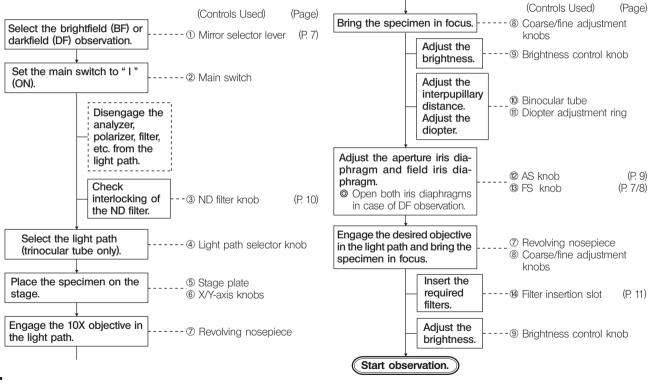

5

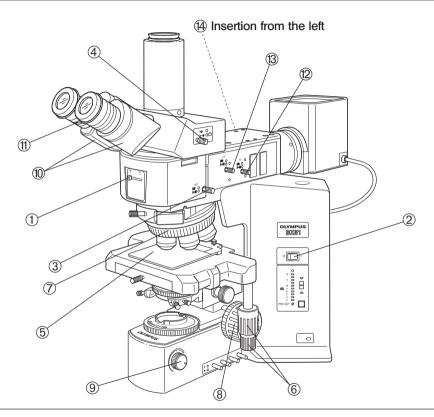

©Make a photocopy of the observation procedure page and post it near your microscope.

## USING THE CONTROLS OF BX-RLA2

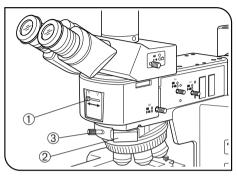


Fig. 1

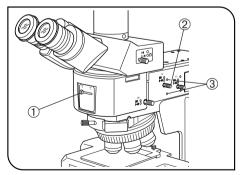


Fig. 2

#### Selecting the Light Path

(Fig. 1)

Slide the mirror selector lever ① toward the indication of the mirror for the desired observation method.

- BF: Reflected light brightfield observation
- DF: Reflected light darkfield observation
- ★ Be sure to slide the mirror selector lever until it contacts the stopper position.


#### Effects of Dummy Slider

The dummy slider ② has been installed on the revolving nosepiece at the factory. It can be replaced by loosening the clamping knob ③ when a DIC prism is to be used. However, in observations other than DIC, be sure to push in the dummy slider in order to prevent flare.

#### 2 Centering the Field Iris Diaphragm (FS)

(Fig. 2)

- 1. Slide the mirror selector lever ① to "BF".
- 2. Engage the 10X objective by rotating the revolving nosepiece, place the specimen on the stage and adjust approximate focusing.
- 3. Pull out the FS knob ② on the reflected light illuminator to reduce the aperture iris stop a little.
- 4. Rotate the two FS centering screws ③ using the Allen screwdriver to adjust so that the field iris image becomes concentric with the field of view.
- 5. While pushing in the FS knob ②, open the field iris diaphragm until the field iris image inscribes the field of view. If the image is found to be eccentric, adjust the centering again.

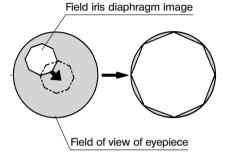

Open the field iris so that its image is almost the same size as (i.e. subscribes) the field of view.

#### Using the Field Iris Diaphragm

#### ●In reflected light brightfield observation

The field iris diaphragm adjusts the illuminated area to obtain an image with high contrast.

According to the objective in use, adjust the FS knob ② of the reflected light illuminator until the iris image circumscribes the field of view to block unnecessary light.

#### ●In reflected light darkfield observation

The field iris must be opened by pushing in the FS knob @.


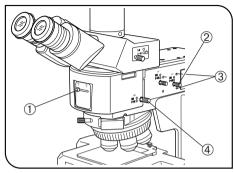


Fig. 3

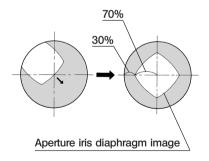

#### 3 Centering the Aperture Iris Diaphragm (AS)

(Fig. 3)

- 1. Slide the mirror selector lever ① to "BF".
- 2. Engage the 10X objective by rotating the revolving nosepiece and bring the specimen in approximate focus.
- 3. Remove the eyepiece, look into the eyepiece sleeve and pull the AS knob ② so that the aperture is about 70%.
- 4. If the center of the iris diaphragm is deviated, center it by rotating the two AS centering screws ③ using the Allen screwdriver.

#### Using the Aperture Iris Diaphragm

- In reflected light brightfield observation, optimum observation is generally possible by setting the aperture to between 70% and 80% of the aperture number of the objective.
- In reflected right darkfield observation, the aperture must be fully opened by pushing in the AS knob ②.
- With some specimens, an image with high contrast and little flare may sometimes obtained when the aperture is slightly closed. It is therefore recommended to also try a slightly closed aperture.

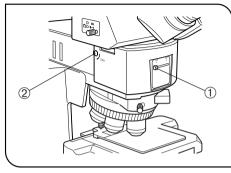


Fig. 4

#### 4 Using the ND Filter Knob

(Fig. 4)

The ND filter is interlocked with the brightfield (BF) light path selecting so it can be engaged or disengaged according to the mirror selector lever ①. The ND filter makes it possible to reduce glare when darkfield (DF) is switched to brightfield (BF).

#### Releasing Interlocking

- The ND filter knob has been interlocked at the factory.
- Of brightness is not enough during brightfield, DIC or other observation, the interlocking can be released.
- 1. Loosen the screw interlocking the ND filter by inserting the Allen screw-driver into the hole ② on the left side of the reflected light illuminator.
- 2. Now the interlocking is released and the ND filter knob (Fig. 3 ④) is active. Pull the knob out to disengage the ND filter from the light path.

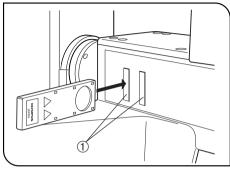


Fig. 5

#### 5 Using the Filters (Fig. 5)

© Engage the optimum filter sliders for the purpose of observation in the two filter insertion slots ①. Be sure to engage from the left side.

The first click position is the idle position and the second click engages the filter in the light path.

Usable Filters	Applications
U-25LBD (Color temperature conversion filter)	Turns the illumination light into daylight. Used in general observations and color photography.
U-25IF550 (Green filter)	Enhanced contrast in monochrome observation. Used in monochrome photography.
U-25Y48 (Yellow filter)	Contrast filter for observation of semiconductor wafers.
U-25ND50-2 (Light intensity adjustment filter)	Adjusts the brightness of the light source. (Transmittance: 50%)
U-25ND25-2 (Light intensity adjustment filter)	Adjusts the brightness of the light source. (Transmittance: 25%)
U-25ND6-2 (Light intensity adjustment filter)	Adjusts the brightness of the light source. (Transmittance: 6%)
U-25FR (Frost filter)	Reduces irregularity in the illumination field, but also reduces the brightness.
U-25L42 (UV cut filter)	Cuts ultraviolet rays. Used to prevent the polarizer from being burned by a high-intensity light source.



## STAGE FOR METALLURGICAL SPECIMENS

To improve the ease of operation, it is recommended to use a stage for exclusive use with metallurgical specimens or replace the stage plate with a specimen holder.

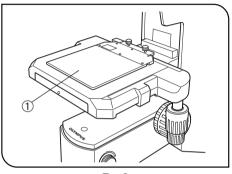


Fig. 6



#### Placing the Specimen

#### With the U-MSSP or U-MSSP4 Stage Plate

Place the specimen on the stage plate ①.

- The specimen should be parallel and planar. Otherwise, the reflected light cannot reach the objective, rendering observation impossible.
- OWhen observing very large specimens, remove the slide plate and place the specimen directly on the stage.

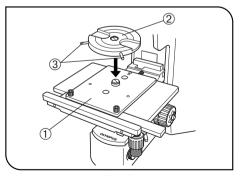


Fig. 7

#### [U-SIC4R2/SIC4L2 Stage Only]

#### Observation with the U-WHP2 Wafer Holder Plate (Fig. 7)

- 1. Place the BH2-WHR43 rotary wafer holder (for 3- or 4-inch) ② on the U-WHP2 wafer holder plate ①.
- 2. Place a 3-inch or 4-inch wafer on the BH2-WHR43 and observe the wafer. The wafer holder plate can be rotated with the knob 3.

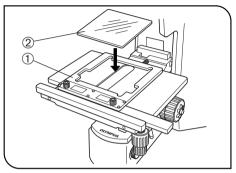


Fig. 8

#### [U-SIC4R2/SIC4L2 Stage Only]

#### Observation with the U-MSSPG Glass Holder Plate (Fig. 8)

- Off the microscope is equipped with transmitted light illumination, transparent specimens can also be observed.
- 1. Place the glass plate 2 gently on the glass holder plate 1.
- 2. Place a specimen or transparent specimen and observe it.

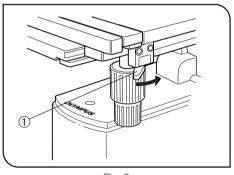


Fig. 9

#### 2 Using the Y-Axis Lock Lever

(Fig. 9)

- This mechanism is provided only with the U-SIC4R2/SIC4L2 stage.
- 1. When the Y-axis movement lock lever ① is locked by setting the lever in the direction of the arrow, the Y-axis movement is locked, making it possible to scan only in the X-axis direction.
- 2. To release the lock, return the lever to the original position.
- ★ If the lock lever is released incompletely, the lever will be worn out, making locking impossible or causing dust.



## OBSERVATION METHODS (Using BX-RLA2)

#### 6-1 Reflected Light Brightfield Observation

See "REFLECTED LIGHT BRIGHTFIELD/DARKFIELD OBSERVATION PROCEDURE" on page 5.

#### 6-2 Reflected Light Nomarski DIC (Differential Interference Contrast) Observation

- ★ The performance of polarizer may deteriorate when it has been exposed to light for a long period (about continuous 2000 hours). If this happens, replace the polarizer.
- ★ When performing sensitive color observation using the U-DICRH DIC slider, combine the U-POTP3 polarizer.
- ★When using the high-intensity light source, be sure to use the U-25L42 filter to prevent the polarizer from being burnt.

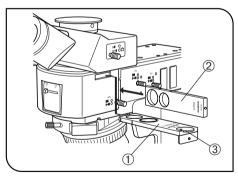


Fig. 10

#### Setting the Analyzer and Polarizer

(Fig. 10)

- ★ In the current step, do not engage the DIC slider in the light path.
- 1. Bring the specimen in approximate focusing using the 10X or 20X objective
- 2. Remove the cover to enable installation of the U-AN360-3 analyzer. Then put the analyzer ① in the insertion slot.
- 3. Insert the U-PO3 or U-POTP3 polarizer ② so that the surface with indication comes on the front, and engage the polarizer in the light path.
- 4. Rotate the analyzer rotating dial ③ to find the position where the field of view is darkest.
- An approximate cross-Nicol position can be obtained by setting the index on the dial ③ on the outer side. Fine-adjust the dial by rotating it near this position to find the position where the field of view is darkest.

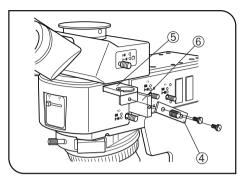


Fig. 11

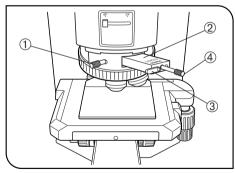


Fig. 12

#### Using the Joint Plate (Fig. 11)

When the U-AN360-3 analyzer ⑤ and U-PO3 or U-POTP3 polarizer ⑥ are coupled by using the joint plate ⑥ provided with the polarizer and tightening the clamping knobs on it, the analyzer and polarizer can be engaged or disengaged in the light path together.

#### 2 Setting the DIC Slider

(Fig. 12)

- 1. Loosen the mounting knob ① on the front of the DIC revolving nosepiece, insert the DIC slider ② so that the surface with indication faces up, and clamp by tightening the mounting knob.
- 2. With the U-DICR interference slider, set the slide lever ③ according to the objective in use.

Lever ③ position		Applicable Objectives
Pushed in	UIS2	MPLFLN/MPLFLN-BD series MPLAPON series
	UIS	UMPlanFI/UMPlanFI-BD series MPlanApo20X, 100X MPlanApo100XBD
Pulled out	UIS2	LMPLFLN/LMPLFLN-BD series
	UIS	LMPlanFl/LMPlanFl-BD series LMPlanApo/LMPlanApo-BD series

3. With the U-DICRH or U-DICRHC slider that does not have the slide lever, the applicable objectives are as follows.

DIC Slider	Applicable Objectives					
U-DICRH	UIS2	MPLFLN/MPLFLN-BD series MPLAPON series				
	UIS	UMPlanFI/UMPlanFI-BD series MPlanFI-BD series MPlanApo20X, 100X				
U-DICRHC	UIS2	LMPLFLN/LMPLFLN-BD series				
	UIS	LMPlanFl/LMPlanFl-BD series LMPlanApo/LMPlanApo-BD series				

#### 3 Observation Method

(Fig. 12)

- 1. Place the specimen on the stage and adjust the focus by moving the stage up or down.
- Adjust the field iris diaphragm so that its image circumscribes the field of view.
- 3. The contrast may sometimes be enhanced by closing the aperture iris diaphragm slightly.

#### U-DICR, U-DICRHC

- 1. Adjust the background contrast by turning the slider movement knob @ on the DIC slider as described below. (Fig. 12)
- 2. When the slider movement knob on the DIC slider is turned, the interference color in the background varies continuously from the gray sensitive color to magenta sensitive color (from -100 to 600 nm). Set the interference color which can provide best contrast with respect to the specimen.
- Selecting a gray background color enables 3D-looking observation with high contrast thanks to the highest sensibility of the gray sensitive color.
- Selecting a magenta sensitive color allows even small phase variation to be observed as a change in color.

#### U-DICRH

- 1. Adjust the background contrast by turning the slider movement knob ④ on the DIC slider as described below. (Fig. 12)
- When the slider movement knob on the U-DICRH DIC slider is turned, the interference color in the background varies from -100 to 100 nm. Set the retardation which can provide best contrast.
- Selecting a gray background color enables 3D-looking observation with high contrast thanks to the highest sensibility of the gray sensitive color.
- Selecting a magenta sensitive color allows even small phase variation to be observed as a change in color.
  - To select the magenta sensitive color as the background color, use the U-POTP3 polarizer and insert it so that the  $\,\lambda\,$  indication can be seen from the front
- ★ Since the DIC observation has a high detection sensitivity, take care against contamination on the specimen surface.
- The detection sensitivity is variable depending on direction so it is recommended to use a rotary stage.

#### 4 Switching to Brightfield/Darkfield Observation (Fig. 12)

- Loosen the mounting knob ① on the front of the DIC revolving nosepiece, gently pull out the DIC slider ② until it clicks, then clamp by tightening the mounting knob.
- 2. Slide the analyzer (U-AN360-3) and polarizer to disengage them from the light path.

#### 6-3 Reflected Light Simplified Polarized Light Observation

© For the preparation of reflected light simplified polarized light observation, perform the operation in "1 Setting the Analyzer and Polarizer" in section 6-2, "Reflected Light Nomarski DIC Observation" on page 14.

#### 1 Observation Method

- Place the specimen on the stage and adjust the focus by moving the stage up or down. Now simplified polarized light observation can be started.
- 2. Adjust the field iris diaphragm so that its image circumscribes the field of view.
- 3. The contrast may sometimes be enhanced by closing the aperture iris diaphragm slightly.

## 7

## **SPECIFICATIONS**

Item	Specification					
Optical system	UIS2 (UIS) (Universal Infinity System) optical system					
Reflected light illumination	Reflected light illuminator (BX-RLA2), tube magnification 1X, super widefield (FN 26.5) compatible.					
	Available observations: ① Reflected light brightfield ② Reflected light darkfield ③ Reflected light Nomarski DIC ④ Reflected light simplified polarized light					




## OPTICAL CHARACTERISTICS «UIS2 Series»

- The UIS series objectives that are not mentioned below can also be mounted on this microscope. -

The table below shows the optical characteristics of different eyepiece and objective combinations. Objective specifications are marked on the objective (as shown in the diagram on the right).

#### (NOTE)

Refer to the latest catalogue or consult Olympus for the updated information on the eyepieces and objectives that can be combined with this unit.

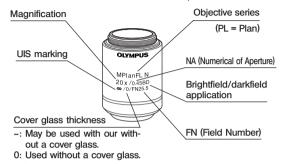

	Optical characteristics  Series Marking					Cover				Eyepi	ieces		
			Magnifi-		W.D.	Cover glass	Resolu-	- WHN10X (FN22) SWH			110X (FN26.5)		
			cation	N.A.	(mm)	thick ness (mm)	tion (µm)	Total mag.	Depth of focus (µm)	Field of view (mm)	Total mag.	Depth of focus (µm)	Field of view (mm)
UIS2	MPLN	MPlanN	5X	0.10	20.0	-	3.36	50X	98	4.4			
series	Plan		10X	0.25	10.6	-	1.34	100X	18	2.2			
	Achromat		20X	0.40	1.3	0	0.84	200X	6.1	1.1	-	-	-
	(FN22)		50X	0.75	0.38	0	0.45	500X	1.4	0.44			
			100X	0.90	0.21	0	0.37	1000X	0.73	0.22			
	MPLN-BD	MPlanN-BD	5X	0.10	12.0	_	3.36	50X	98	4.4			
	Brightfield/		10X	0.25	6.5	-	1.34	100X	18	2.2			
	darkfield		20X	0.40	1.3	0	0.84	200X	6.1	1.1	-	-	-
	Plan Achromat (FN22)		50X	0.75	0.38	0	0.45	500X	1.4	0.44			
	· · · · · · · · · · · · · · · · · · ·		100X	0.90	0.21	0	0.37	1000X	0.73	0.22			
	MPLFLN	MPlanFLN	1.25X	0.04	3.5	-	8.39	12.5X	870	17.6	_	-	_
	Plan Semi-		2.5X	0.08	10.7	_	4.19	25X	220	8.8	25X	220	10.6
	Apochromat		5X	0.15	20.0	-	2.24	50X	59	4.4	50X	59	5.3
	(FN26.5)		10X	0.30	11.0	-	1.12	100X	15	2.2	100X	15	2.65
	*1.25X:FN22		20X	0.45	3.1	0	0.75	200X	5.2	1.1	200X	5.2	1.33
			50X	0.80	1.0	0	0.42	500X	1.3	0.44	500X	1.3	0.53
			100X	0.90	1.0	0	0.37	1000X	0.73	0.22	1000X	0.73	0.27

		Optical				0	Eyepieces						
	ch	naracteristics	Magnifi-		W.D.	Cover glass	Resolu-	WHN10X (FN22)			SWF	110X (FN:	26.5)
	Series	Marking	cation	N.A.	(mm)	thick ness (mm)	tion (µm)	Total mag.	Depth of focus (µm)	Field of view (mm)	Total mag.	Depth of focus (µm)	Field of view (mm)
UIS2	MPLFLN-BD	MPlanFLN-BD	5X	0.15	12.0	_	2.24	50X	59	4.4	50X	59	5.3
series	Brightfield/		10X	0.30	6.5	_	1.12	100X	15	2.2	100X	15	2.65
	darkfield		20X	0.45	3.0	0	0.75	200X	5.2	1.1	200X	5.2	1.33
	Plan Semi-		50X	0.80	1.0	0	0.42	500X	1.3	0.44	500X	1.3	0.53
	Apochromat		100X	0.90	1.0	0	0.37	1000X	0.73	0.22	1000X	0.73	0.27
	(FN26.5)		150X	0.90	1.0	0	0.37	1500X	0.6	0.15	1500X	0.6	0.18
	MPLFLN-BDP	MPlanFLN-BDP	5X	0.15	12.0	-	2.24	50X	59	4.4	50X	59	5.3
	Reflected Polarized		10X	0.25	6.5	-	1.34	100X	18	2.2	100X	18	2.65
	Light Plan Semi-	50)	20X	0.40	3.0	0	0.84	200X	6.1	1.1	200X	6.1	1.33
	Apochromat			0.75	1.0	0	0.45	500X	1.4	0.44	500X	1.4	0.53
	(FN26.5)		100X	0.90	1.0	0	0.37	1000X	0.73	0.22	1000X	0.73	0.27
	LMPLFLN	LMPlanFLN	5X	0.13	22.5	_	2.58	50X	70	4.4	50X	70	5.3
	Long-WD Plan		10X	0.25	21.0	-	1.34	100X	18	2.2	100X	18	2.65
	Semi-Apochromat		20X	0.40	12.0	0	0.84	200X	6.1	1.1	200X	6.1	1.33
	(FN26.5)		50X	0.50	10.6	0	0.67	500X	2.5	0.44	500X	2.5	0.53
			100X 5X	0.80	3.4	0	0.42	1000X	0.87 70	0.22	1000X 50X	0.87 70	0.27
	LMPLFLN-BD	LMPlanFLN-BD	10X	0.13 0.25	15.0 10.0	-	2.58 1.34	50X 100X	18	4.4 2.2	100X	18	5.3 2.65
	Brightfield/darkfield		20X	0.25	12.0	0	0.84	200X	6.1	1.1	200X	6.1	1.33
	long-WD Plan Semi- Apochromat (FN26.5)		50X	0.40	10.6	0	0.67	500X	2.5	0.44	500X	2.5	0.53
			100X	0.80	3.3	0	0.67	1000X	0.87	0.44	1000X	0.87	0.33
	SLMPLN Superlong-WD Plan Achromat	OLANDI AT								_			
		SLMPlanN	20X	0.25	25.0	0	1.34	200X	11.4	1.1	200X	11.4	1.33
			50X	0.35	18.0	0	0.96	500X	4.2	0.44	500X	4.2	0.53
	(FN26.5)		100X	0.60	7.5	0	0.56	1000X	1.3	0.22	1000X	1.3	0.27

Note) When an MPLN-BD series objective is used in darkfield observation with a xenon light source, the peripheral area may be obscured with certain specimens.


	Optical characteristics					Cover				Eyepi	eces		
			Magnifi-	NI A	W.D.	glass	Resolu- tion	- WHN10X (FN22) SWH10X (FI			110X (FN2	26.5)	
	Series	Marking	cation	N.A.	(mm)	thick ness (mm)	(µm)	Total mag.	Depth of focus (µm)	Field of view (mm)	Total mag.	Depth of focus (µm)	Field of view (mm)
UIS2	MPLAPON Plan	MPlanApoN	50X	0.95	0.35	0	0.35	500X	0.7	0.44	500X	0.7	0.53
series	Apochromat	· ·	100X	0.95	0.35	0	0.35	1000X	0.4	0.22	1000X	0.4	0.27

#### Objectives for LCD Panel

	Optical characteristics					Cover		Eyepieces					
			Magnifi-		W.D.	glass	Resolu- tion	WHN10X (FN22) SWH10X (					26.5)
	Series	Marking	cation	N.A.	(mm)	thick ness (mm)	(µm)	Total mag.	Depth of focus (µm)	Field of view (mm)	Total mag.	Depth of focus (µm)	Field of view (mm)
UIS2	LCPLFLN	LCPlanFLN*	20XLCD	0.45	7.4-8.3	0-1.2	0.75	200X	5.2	1.1	200X	5.2	1.33
series	Long-WD Plan		50XLCD	0.70	2.2-3	0-1.2	0.48	500X	1.6	0.44	500X	1.6	0.53
	Semi-Apochromat (FN26.5)		100XLCD	0.85	0.9-1.2	0-0.7	0.39	1000X	0.79	0.22	1000X	0.79	0.27

<sup>\*</sup> Equipped with the glass thickness compensation ring.

#### Significance of Objective Name

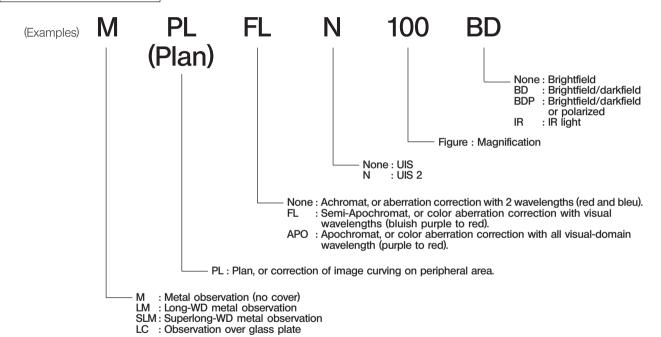

#### Glossary of Terms Used in the Optical Characteristics Table

Working distance (WD) : The distance from the top of specimen and the front lens of objective.

Number of aperture (NA): Important figure determining the objective characteristics (resolution, focal depth and bright-

ness).

Resolution........Increases in proportion with the NA Focal depth.......Decreases in proportion with the NA

Resolution : The limit that an objective can identify the images of two points that are close to each other,

expressed as the distance between the two points on the specimen.

Depth of focus : The maximum depth of the specimen at which the entire specimen can be brought into focus

simultaneously. This value increases when the aperture iris diaphragm is narrowed and de-


creases when the objective NA is increased.

Field number : The diameter of the image area that can be observed through the eyepieces, expressed in mm.

Field of view : The diameter of the area observable on the specimen, expressed in mm.

## 9 ASSEMBLY

The following diagram is applicable only to the BX51RF/BX51TRF microscopes. For the BXFM-F focusing unit, please refer to its instruction manual.

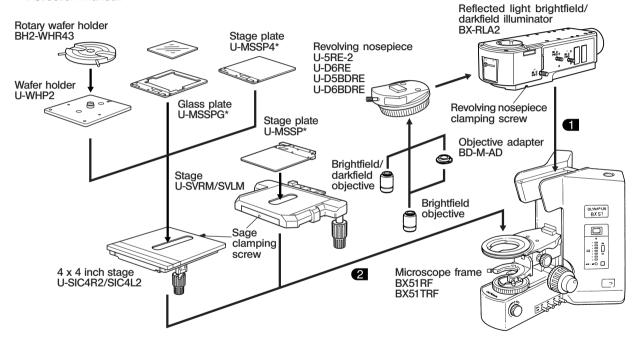

- \* Warp prevention pins (2 for each) are attached on the bottom sides of the U-MSSP/MSSP4 stage plate and the U-MSSPG glass plate when the system is shipped from the factory. Remove the pins before use.
- ★ When the stage plate of a U-SVRB-4/SVLB-4 biological observation stage is replaced, the back side of the stage plate may wear out after long period of use because the top side of biological observation stage is coated with ceramic.

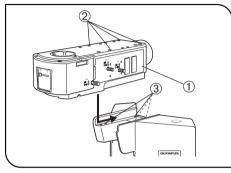


Fig. 13

#### 1 Attaching the Illuminator

(Fig. 13)

- Attach the illuminator using the exclusive 4 mm Allen wrench ( provided with it.
- @Remove the caps of the mounting screws @ using tweezers, etc.
- Place the illuminator ① on the mounting surface by slightly deviating the mounting screw ② of the illuminator toward the front of the mounting screw holes ③ on the microscope frame. For the present, it is not required to align the illuminator's mounting screws with the microscope's mounting screw holes.
- 2. Apply the illuminator toward the rear of the microscope frame. The illuminator will fit in the correct position.
- 3. While maintaining the correct condition, tighten the 4 clamping screws ② by turning it clockwise using the 4 mm Allen wrench.
- 4. Place the caps of mounting screws ② on the original position

#### 2 Attaching the Stage

Tighten the stage clamping screw.

## **OLYMPUS**

